




TECHNICAL BULLETIN TB07-2014

Regarding: Securing and sealing the switch

If the seal is broken and EPIRB is not activated, it may be re-sealed using the procedure below

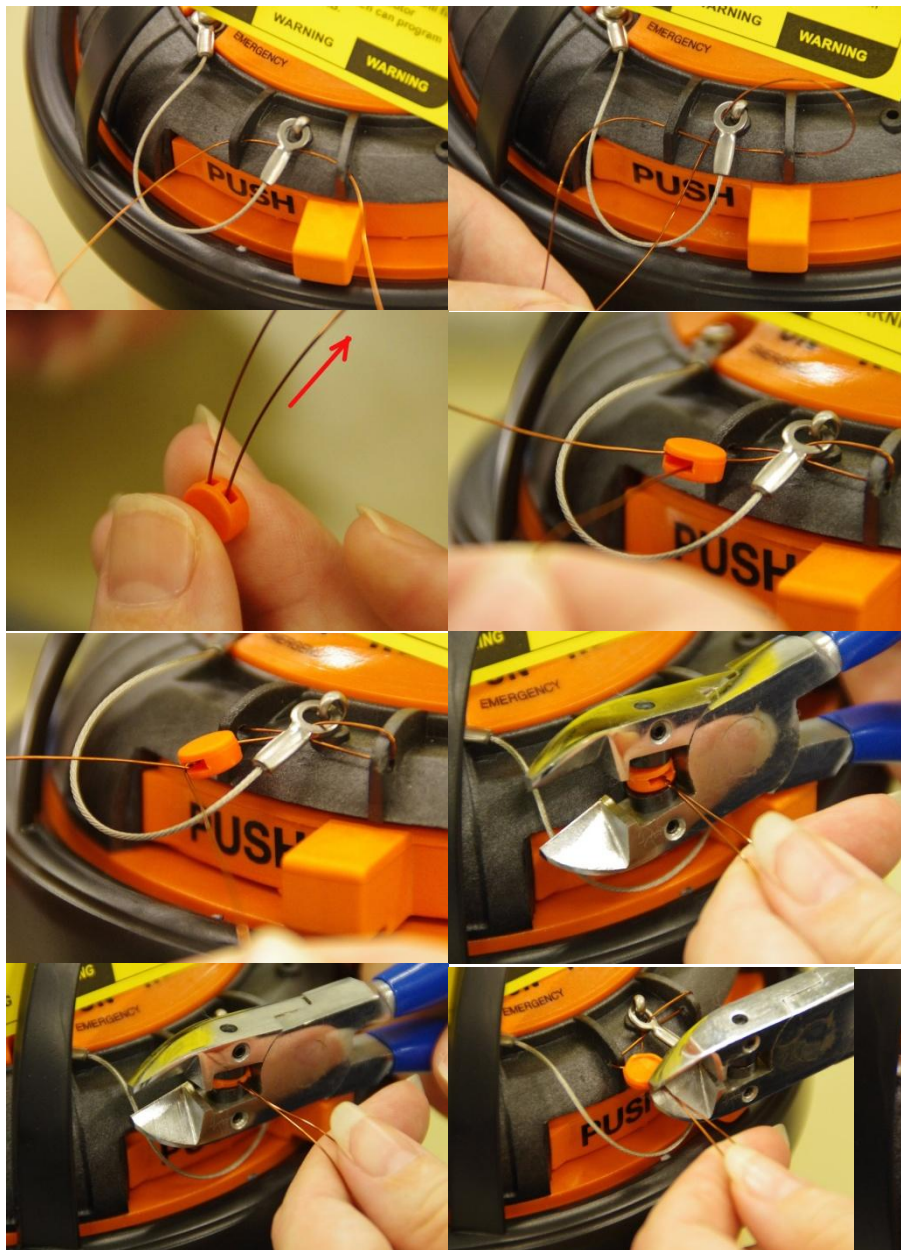

- Thread the lacquered copper wire as shown in the two first pictures
- Thread the ends through a new seal, red arrow shows direction of the EPIRB. The end of the seal with two holes shall be pointing to EPIRB; the end with rectangular hole shall point outward.
- Twist the ends of copper wire as shown in picture
- Use special pliers to compress the seal and then cut off the ends of the copper wires

Jotron 29.10.2014

DNB Bank asa | 0021 Oslo | Norway | Bank account: 24400508514 | IBAN: NO6624400508514 | BIC: DNBANOKK | Reg.no.: NO917713324 MVA
QA Certificate: NS-EN ISO 9001:2008/ISO 14001:2004

www.jotron.com

Jotron AS
P.O. Box 54 | NO-3281 Tjodalyng | Norway

Tel: +47 33 13 97 00
Fax: +47 33 12 67 80